

Tehničke karakteristike artikla: HSELDA49MP

FTTH Naz.utičnica 4xLC/APC 8°(2dx), OS2, G657.A2, 80x80x28, IP45

RAL9010 (čisto bela), mogućnost DIN montaže, B2ca-s1a,d0,a1, IP45



SCHRACK-Info

FTTH OS2 LC/APC outlets are designed for single-mode fiber optic cables, which offer long transmission distances and low attenuation.

The LC/APC connectors ensure that the fiber-optic connection is stable and reliable.

LC/APC connectors are preferred for compact installations and high connection density.

This type of connector is characterized by its precise mating and low return loss, resulting in minimal signal loss.

Features

- Fiber Optic In-House-Cabling

- Offers connection options for up to 4 end devices
- Inclusive 2x Duplex-Couplers and 4x Pigtails inserted and prepared ready for splicing

Optional Accessories

Coupler:

- HSELSK09MR

Pigtail:

- HLP09M041P

Safety information:

Avoid direct contact with light sources:

- Fiber optic cables—especially those with active light sources such as lasers (e.g., in optical communication systems)—can emit hazardous radiation that may damage the eyes.
- Never look directly into the light of a fiber optic cable, even if the light source is invisible to the naked eye.

Wear protective eyewear:

- When working with fiber optic cables, especially during tests or when using lasers, always wear safety glasses to protect your eyes from harmful radiation.

Handle cables correctly:

- Plug in and unplug cables only by holding the connector, and never pull directly on the cable.

Do not bend or crush:

- Fiber optic cables are sensitive to mechanical stress.

Protect from damage:

- Install cables in dedicated conduits or use protective materials to prevent physical damage.

Keep connectors clean:

- Fiber optic connectors must be free of dust and dirt.
- Even small particles on the connectors can significantly reduce signal quality.

Observe temperature limits:

- Do not expose cables to extremely high or low temperatures.
- Follow the manufacturer's specifications for the cable's maximum operating temperature.


Inspect regularly:

- Frequently check cables for visible damage such as cracks, bends, or signs of wear.
- Damaged cables must be replaced immediately.


Tehnički podaci

Neto širina (mm)	80,00
Neto visina (mm)	28,00
Neto težina (kg)	0,06
Standard proizvoda	IEC 61300-3-4 / IEC 61300-3-6
Kombinacija utičnica	LC/APC
Tip konektora	LC/APC 8° Ferrule
Vlakno	9/125 OS2 Singlemode / G.657.A2
Opis boje	RAL 9010 (čisto bela)
Gubitak insertacije tipičan (dB)	≤0,25
Povratni gubitak tipičan (dB)	≥60
Talasna dužina (nm)	1310
Min. temperatura okoline (°C)	-40
Maks. temperatura okoline (°C)	75






**Dimenzija: FTTH Naz.utičnica 4xLC/APC
8° (2dx), OS2, G657.A2, 80x80x28, IP45**

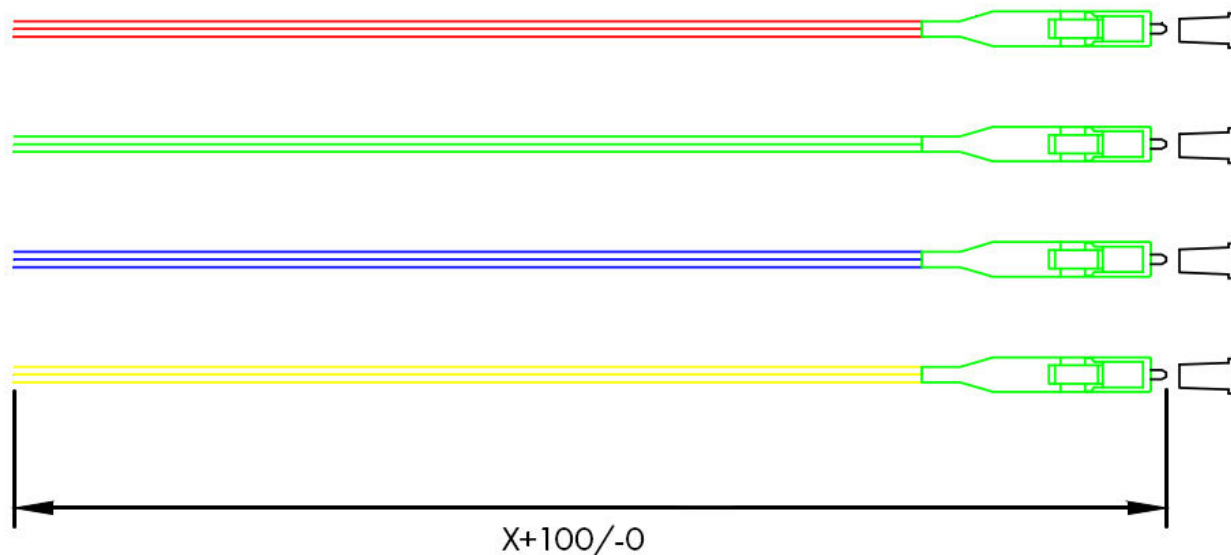

**Dimenzija: FTTH Naz.utičnica 4xLC/APC
8° (2dx), OS2, G657.A2, 80x80x28, IP45**

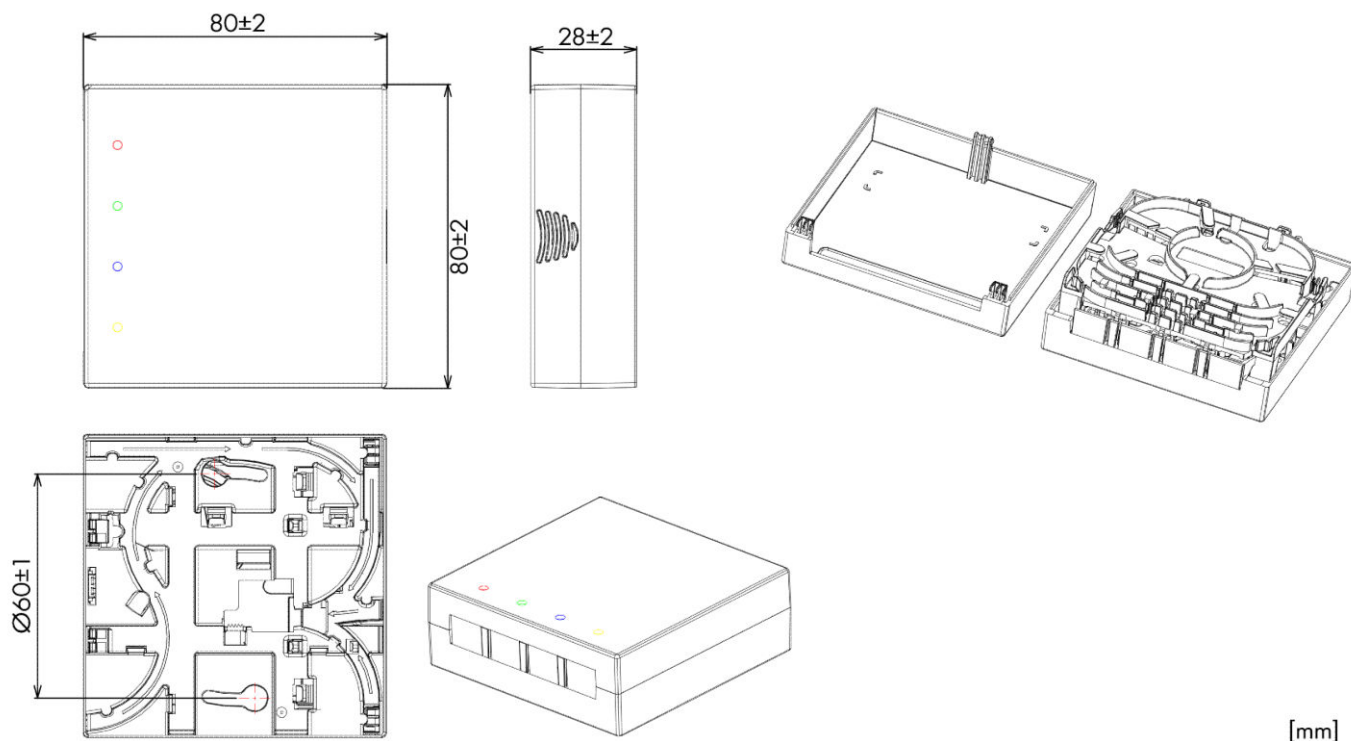

**Dimenzija: FTTH Naz.utičnica 4xLC/APC
8° (2dx), OS2, G657.A2, 80x80x28, IP45**

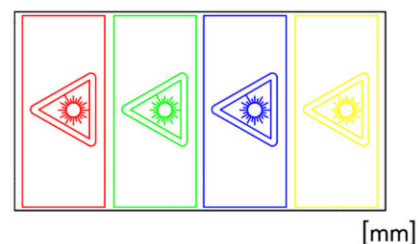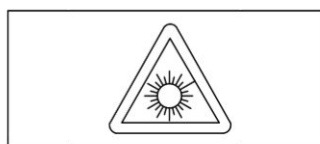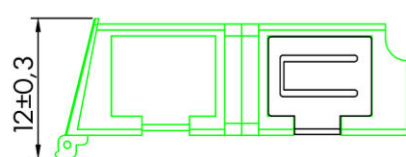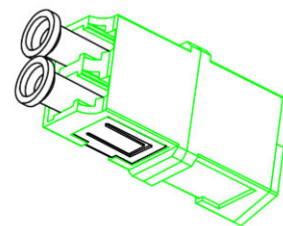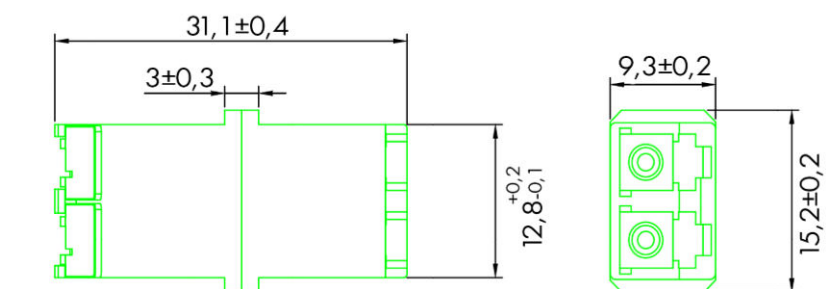

[mm]

Tabela artikla

OPIS	Kat. broj
FTTH Naz.utičnica 4xLC/APC 8°(2dx), OS2, G657.A2, 80x80x28, IP45 RAL9010 (čisto bela), mogućnost DIN montaže, B2ca-s1a, d0, a1, IP45	HSEDA49MP
Dodatni pribor	
Alat za čišćenje FO adaptera/konektora "One-Click"(LC, MU) za UPC/APC	HSELSZT001
Tester FO signala (sa integrisanim VFL) i RJ45 tester kabla PAŽNJA: ovo je izvor svetla Laser klase 2. Nikada ne gledajte u izvor. Uvijek koristite pokrov na VFL portu kad nije u uporabi. Preporučujemo uporabu specijalnih naočala za rad s laserskim izvorima svetla.	HSELSZT003
FO Patch LC/APC-LC/APC, OS2, duplex, LS0H, žuti, 2m APC-APC, LS0H	HLP29MM02F
FO Patch LC/UPC-LC/APC, OS2, duplex, LS0H, žuti, 2m UPC-APC, LS0H	HLP29LM02F
FO Patch SC/UPC-LC/APC, OS2, duplex, LS0H, žuti, 2m UPC-APC, LS0H	HLP29CM02F